



**TONY D. BRANDA PERFORMANCE  
1434 E. PLEASANT VALLEY BLVD.  
ALTOONA, PENNSYLVANIA 16602**

**Shelby & Mustang Parts**

(814) 942-1869 9 a.m.-10 p.m.

**\*\*\*\*\*Important Notice On Fitting\*\*\*\*\***

**\*\*\*\*NOTE\*\*\*\***

**Clearance Problems With New Tall Type/Roller Type Small Block Cobra Valve Covers...**

**With Stock Heads Ford Motorsport Rocker Arms May Hit On Each End Rocker.  
Remedy's Are To Double Up On Gaskets And Or Grind A Small Amount Of The Rocker Arm  
Corners Off To Clear. Grinding A Small Amount Under Valve Cover On Corners.**


**\*\*\*NOTE\*\*\* Double Thick Ford Small Block Valve Cover Gaskets Are Available If  
Needed Felpro # 1645 And These Will Give 5/16" Extra Clearance.**

**With Aftermarket Heads Such As Edelbrock And Twisted Wedge Etc. Clearance May Be  
A Problem With Underside Oil Baffles And Above Modifications May Or May Not Help.  
(Removal Of Oil Baffles And Grinding Off Rivit Posts May Also Be Done If Needed.)**

**Poly Locks May Hit Underside Of Valve Covers And Again Double Gaskets Will Normally  
Take Care Of This.**

**Due To The Fact That There Are So Many Variations With Heads And Componants We Cannot  
Guarantee These Covers Will Fit All Applications And The Above Modifications May Be  
Needed To Assure Correct Fitting.**

**Thank You  
Tony D. Branda Performance  
Shelby & Mustang Parts.**

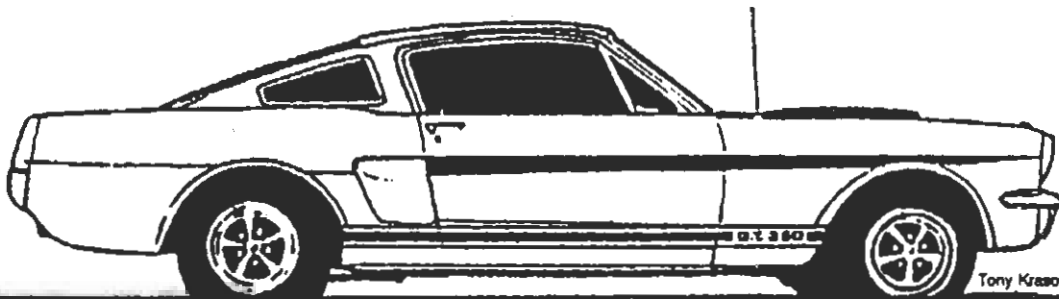

Tony Krasowski © 1984

**SHELBY G.T. 350**